

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Apramo	Booster	Apramo	046-6045 (K11-1618CTC) 199-5607 (K11-1631CTC)	September 2013 to September 2015	Does not meet the stiffness requirements of the RSSR.	Discontinue use; return affected product to Canadian Tire
Bébécar	RFO	EASYMAXI XL	0797 0798	13-Mar-2018	Some parts of the carrying handle may not be properly attached.	Contact Meubles Adams for handle fix.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	RFO	B-Safe 35 B-Safe 35 Elite Bob B-Safe 35	B-SAFE 35 & TRAVEL SYSTEMS: E1A193F, E1A195M, E1A195P, E1A196X, E1A196Z, E9LV16R, E9LV17D, S04144700, S04144800, S04144900, S04183700, S04183800, S04437700, S04884400, S04884500, S06051400, S06051500, S06051600, S06051700, S06051800 B-SAFE 35 ELITE & TRAVEL SYSTEMS: E9LV21Q, E9LV26C, E9LV26L, E9LV27F, E9LV27G, E9LV2Q8, S01298700, S04184000, S06051300 BOB B-SAFE 35: E9LT54A, E9LT54C, E9LT55X	1-Nov-2015 through 31-May-2017	The center tab on the chest clip may break off, which could present a choking hazard to an infant in the car seat.	Contact Britax for a replacement chest clip.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	RFO	B-Safe 35	E9LV15M E9LV15P E9LV13F S914300 S914700 S914500	1-Oct-2014 to 1-Jul-2015	The infant car seat carry handle can develop cracks and break allowing the seat to fall unexpectedly, posing a risk of injury to the infant.	Do not lift or carry by the handle until repair kit has been installed.
Britax	Convertible	Advocate ClickTight	E9LV55N E9LV55Q E9LV55Z	1-Aug-2014 to 29-Jul-2015	Harness adjuster buttons (red) may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat.	Call Britax for fix kit (lubricant for adjuster mechanism)
Britax	Convertible	Boulevard ClickTight	E9LV45Q E9LV45S E9LV46A E9LV46H	1-Aug-2014 to 29-Jul-2015	Harness adjuster buttons (red) may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat.	Call Britax for fix kit (lubricant for adjuster mechanism)
Britax	Convertible	Marathon ClickTight	E9LV31Q E9LV35R E9LV36B E9LV36L E9LV36N	1-Aug-2014 to 29-Jul-2015	Harness adjuster buttons (red) may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat.	Call Britax for fix kit (lubricant for adjuster mechanism)
Britax	Combination	Pioneer	E9LM61A E9LM63G E9LM63W E9LM64J E9LM64K	6-Aug-2013 to 1-Feb-2014	The instruction manuals and product labelling incorrectly indicate that the seats are not certified for use in an aircraft.	Call Britax for updated user manual

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	Combination	Frontier ClickTight	E9LM71A E9LM73P E9LM74L E9LM74M E9LM74N	21-May-2013 to 1-Feb-2014	The instruction manuals and product labelling incorrectly indicate that the seats are not certified for use in an aircraft.	Call Britax for updated user manual
Britax	Combination	Pinnacle ClickTight	E9LM84P E9LM84Q E9LM84R	21-May-2013 to 1-Feb-2014	The instruction manuals and product labelling incorrectly indicate that the seats are not certified for use in an aircraft.	Call Britax for updated user manual
Chicco	RFO	KeyFit 30	7901201 7901210 7901250 7901302 7910202 7910505 7910568 7923705 7923750 7923751 7923768 7923770 7923781 7974736 7974872, 7976108 7976140 7976151 57976151	30-Dec-2013 to 21-May-2018	The infant seat did not meet the dynamic requirements for chest acceleration of the RSSR.	Acquire a fix kit. Continue to use the car seat using the universal anchorage system (UAS), lap only portion of the vehicle seat belt, or without the base until they receive a retrofit kit.
Clek	Booster	Oobr	OOBR - Noire colour only	1-Apr-2016 to 22-Nov-2016	Noire colour only; may not conform to the flammability requirements.	Obtain replacement fabric from Clek.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Clek	Convertible	Foonf	F012C1 FOONF C1 2014 Foonf F014C1 F015C1 F016C1	1-Dec-2012 to 10-May-2016	When installed forward-facing with a lap belt only and top tether in Recline Position 1, the car seat did not meet the dynamic requirements for chest acceleration of the RSSR.	Use Recline Position 2 when FF with lap belt and tether; contact Clek for updated labels.
Cosco - see Dorel						
Diono	RFO	Radius		ALL	Counterfeit, do not use.	Call Transport Canada
Diono	3-in-1	Radian R100	All	March 2011 to January 2012	Incorrect Weight on French Label	Call Diono
Diono	3-in-1	Radian R100 Radian R120 Radian RXT Radian GTX	C16600 C16800 C16900 C18600	Jan 2013 through November 2013	Radian child restraints were shipped without the required memory foam insert in the seat pan fabric	Call Diono
Diono	Booster	Cambria Hip Backless Jet Backless	310000 221250 221200	22-Apr-2016 through 31-Dec-2016	The fabric pad of the affected booster seats do not conform to the flammability requirements	Call Diono for replacement cover.
Diono	Booster	Cambria	31010-CA 31030-CA 31110-CA 31120-CA	15-May-2014 to 15-Feb-2015	In the case of a vehicle fire, the fabric cover may not self-extinguish or may burn too quickly, accelerating the spread of the fire.	Contact Diono as soon as possible to obtain a replacement cover.
Diono	Booster	Cambria 2	31200-CA-01 31201-CA-01 31202-CA-01	5-Sep-2020 to 30-Nov-2020	The headrest can completely separate during dynamic crash testing and do not meet the full dynamic requirements of the RSSR.	Contact Diono; remove the backrest and use backless until receiving a replacement kit.
Eddie Bauer - see Dorel						

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	Convertible	SureRide	37111324C 37111334C 37111435C 37111623C 37111640C	17-Jun-2013 to 13-Aug-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	Convertible	Titan 65	37111447C 37121597C	12-Dec-2013 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	Combination	Evolve 3-in-1	34411700C	Prior to 9-Feb-2016	Some children are able to reach the harness adjustment button and are loosening the harness.	Contact Evenflo
Evenflo	3-in-1	Symphony	34511125C 34511264C 34511266C 34511650C 3451881C 3451953C 34521266C 3452881C 3452953C 34611038C 34611106C 34611176C 34611358C 34611376C 34611476C 34611587C 34611648C 34621038C 34621358C 34621376C 34631038C 34631358C 34641358C	31-Jan-2013 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	3-in-1	Snugli All In One	34611341C 34611364C 34621341C 34621364C	7-Aug-2014 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	3-in-1	Symphony DLX, 65, LX/Snugli All in One	34511125C 34511264C 34511266C 34611038C 34611341C 34611358C 34611364C 34611376C 34621038C 34621358C 34621376C	30-Nov-2012 to 17-Jan-2013 30-Nov-2012 to 26-Aug-2013 30-Nov-2012 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 31-Jan-2013 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 31-Jan-2013 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 25-Jan-2013 to 2-Aug-2013 30-Jan-2013 to 26-Aug-2013 30-Jan-2013 to 26-Aug-2013	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo for new buckle
Ferrari - see TeamTex						
Fisher-Price - see TeamTex						
Graco	Convertible	MyRide 65	1910553 1910552 1910395	14-May-2014 to 18-Jul-2014 11-Jul-2014 to 30-Jul-2014 14-May-2014	The webbing of the affected restraints do not conform to the breaking strength requirements indicated in the RSSR. Affected units have webbing tag code "2014/06"	Call Graco at 1-800-345-4109 for replacement harness; use existing harness in the meantime.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Graco	Combination	Nautilus	1749108 1749109 1749110 1749111 8J00GLX 8J00MTX 8J00BRV 8J00RSE 1759875 1773654 1782514 1783809 1784468 1803181 1803185 1803201 1804171 1809667 1810497 1813596 1857000 1857051 1859859 1861577	September 2008 to July 2013	On certain Graco Nautilus and MyRide 65 model child car seats manufactured between September 2008 and July 2013, the buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Call Graco at 1-800-345-4109
Graco	Booster	Turbo	1971444 1970763	27-Feb-2016 to 12-Apr-2016 26-Feb-2016	The instruction manual does not contain a statement indicating that the booster seat, even when unoccupied, must be firmly secured to the vehicle.	Download revised manual; secure booster to vehicle.
Harmony	Combination	Optyma	0302010RBK	27-Dec-2017 to 2-Jan-2018 with serial number ranges YY20171227677200001-00489 YY20171229677300001-00473 YY20180102677400001-00473 YY20171229677700001-00060	If the straps are positioned without covering the opening on the splitter plate, they can potentially loosen or become unsecured from the splitter plate.	Contact Harmony for sleeve to cover splitter plate opening

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Harmony	Booster	Big Boost Deluxe	0304018CBR	30-Jan-2016 to 31-Dec-2017	Did not meet the dynamic requirements for chest acceleration.	Re-route the shoulder portion of the vehicles lap-and-shoulder seat belt over the armrest of the booster seat. Contact Harmony.
Little Tikes - see Diono						
KidsEmbrace	Combination	KidsEmbrace Friendship Series	Cinderella (Model Number: 40000CINCAN) TMNT Leo (65500LEOCAN) Ultimate Spider-Man (40000SPDCAN)	Cinderella: 2015-02-02 and 2015-02-06 TMNT Leo : 2015-01-09 to 2015-11-06 Ultimate Spider-Man: 2015-01-09 to 2015-11-06	The lower connector system does not meet the dimensional requirements of CMVSS; the connector appears to be too long.	Install with seat belt if connectors are too long; call for new connectors.
KidsEmbrace	Combination	KidsEmbrace Friendship Series Cinderella Combination Booster Seat	40000CINCAN	2-Feb-2015 to 6-Feb-2015	An English label incorrectly states the booster seat can be used for children with a minimum weight of 14 kg (30 lbs). The weight range is 18 to 45 kg (40 to 100lbs).	Do not use the product as a belt-positioning booster if the child weighs less than 18 kg (40 lbs). Contact KidsEmbrace for replacement label.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Kukuxumusu	Booster	Kukuxumusu	046-0735 (KU20143CM) 046-0736 (KU20153CM)	February 2013 to September 2015	Does not meet the stiffness requirements or conform to flammability requirements of the RSSR.	Discontinue use; return affected product to Canadian Tire
Orbit Baby Inc.	RFO	Orbit Baby G3 Infant Car Seat	ORB832300	December 2013 through December 2016	Does not meet dynamic testing requirements when used without the base; does not meet label permanceney requirements.	Contact Orbit Baby. Do not use without the base.
Safety 1st - see Dorel						
Recaro	Convertible	Performance RIDE	337.01.KNGT 337.01.MNGT 337.01.REDD 337.01.VIBE	30-Oct-2015 to 19-Jan-2016 13-Oct-2015 to 4-Dec-2015 3-Nov-2015 to 4-Dec-2015 16-Oct-2015 to 17-Feb-2016	Do not meet the dynamic requirements for head acceleration in the RSSR.	Use bottom half of infant insert to 35lb limit RF; remove weight limit tag; get updated manual. Contact Recaro.
Recaro	Convertible	Performance RIDE	337.01.MNGT 337.01.KNGT 337.01.VIBE 337.01.REDD	13-Oct-2015 to 3-Nov-2015	The date of manufacture on the side of the child restraint was misprinted and may be inconsistent with normal date formats.	Contact Recaro for replacement label.
Snugli - see Evenflo						

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Sparco	Booster	No Back Booster	00924AZ+NRGR	all	In the case of a vehicle fire, the fabric cover may not self-extinguish or may burn too quickly, accelerating the spread of the fire.	Discontinue use of their product; return to Canadian Tire for refund.
TeamTex	Combination	Fisher-Price Safe Voyage Grow-with-Me	FP3000C	November 30 2012 to August 27, 2013	Misleading language in manual - harness should be at or JUST above the shoulders.	Use harness at or JUST above shoulders; obtain new manual.
TeamTex	Combination	Fisher-Price Safe Voyage Grow-with-Me	FP3000C	14-Jun-2013 to 27-Aug-2013	Certain child restraint systems may not conform to the flammability requirements indicated in the RSSR	Contact 5514km
TeamTex	Booster	Ferrari Befix High Back Booster	F4000C	13-Aug-2013 16-Aug-2013 27-Aug-2013 5-Sep-2013 6-Sep-2013 9-Sep-2013 12-Sep-2013 17-Sep-2013 19-Sep-2013 25-Sep-2013	Possible incorrect shoulder belt routing instructions for two different belt guide types. Without the correct instructions, it may be possible to have the vehicle shoulder belt routed incorrectly, preventing the belt from sliding freely in the guide.	Contact the 5514 KM Corporation and obtain revised instructions if current ones do not match type on seat.

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
TeamTex	Booster	Barbie Sparkle Backless Booster Ferrari Dream Backless Booster Ferrari Befix High Back Booster Ferrari Beline Car Seat Fisher-Price Safe Voyage Backless Booster Fisher-Price Safe Voyage High Back Booster Fisher-Price Safe Voyage Grow with Me Car Seat Hot Wheels Flame Backless Booster Hot Wheels Speedway Backless Booster	MB5000C F5000C F4000C F3000C FP5000C FP4000C FB3000C MH5000C MH5000C	November 30 2012 to June 5 2014	Some labels on the affected booster seats and certain sections in the instruction manual indicate a minimum height of 40 inches (102 cm), while others indicate a minimum height of 42 inches (107 cm). In addition, there are some translation errors between the English and French manuals.	Contact the 5514 KM Corporation for updated labels and manual. Utilize minimum height of 42" (107cm)
UPPAbaby	RFO	Mesa	0209-JKE 0209-DNY 0209-GEO 0209-PAS 0209-LSY	17-Oct-2015 to 21-Mar-2017	An installation diagram label at the belt path incorrectly shows the position of the carry handle when the car seat is installed in a vehicle.	Use forward "vehicle use" handle position in the vehicle; contact UPPAbaby for a corrected label

Recall List - updated 13-May-2021. While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or the seat's manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada, www.cpsac.org

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Volvo	Booster		850 - 1998 S40 - 01-05 V40 - 01-04 V50 - 05-06 V70 - 00-06 XC70 - 01-06 XC90 - 03-06	See list at left	Inappropriate weight range.	Do not use integrated booster until 40lbs