

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Apramo	B	Apramo	046-6045 (K11-1618CTC) 199-5607 (K11-1631CTC)	September 2013 to September 2015	Does not meet the stiffness requirements of the RSSR.	Discontinue use; return affected product to Canadian Tire
Apramo	B	Sparco	#199-5955-6 (7F30408902000)	24-Aug-2012	Missing expiry date - May 29, 2018; incorrect contact information	Note correct expiry date

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	I	B-Safe 35 B-Safe 35 Elite Bob B-Safe 35	B-SAFE 35 & TRAVEL SYSTEMS: E1A193F, E1A195M, E1A195P, E1A196X, E1A196Z, E9LV16R, E9LV17D, S04144700, S04144800, S04144900, S04183700, S04183800, S04437700, S04884400, S04884500, S06051400, S06051500, S06051600, S06051700, S06051800 B-SAFE 35 ELITE & TRAVEL SYSTEMS: E9LV21Q, E9LV26C, E9LV26L, E9LV27F, E9LV27G, E9LV2Q8, S01298700, S04184000, S06051300 BOB B-SAFE 35: E9LT54A, E9LT54C, E9LT55X	1-Nov-2015 through 31-May-2017	The center tab on the chest clip may break off, which could present a choking hazard to an infant in the car seat.	Contact Britax for a replacement chest clip.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	I	B-Safe 35	E9LV15M E9LV15P E9LV13F S914300 S914700 S914500	1-Oct-2014 to 1-Jul-2015	The infant car seat carry handle can develop cracks and break allowing the seat to fall unexpectedly, posing a risk of injury to the infant.	Do not lift or carry by the handle until repair kit has been installed.
Britax	I/C	Roundabout 55 Marathon 65 Boulevard 65 Boulevard 65 CS Advocate 65 CS	all	September 1, 2010 to September 1, 2011	Joint connectors detaching from base	Contact Britax for fix kit.
Britax	I/C	Advocate	E9LG91A E9LG93N E9LG93P E9LG93X E9LG93Y	June 1, 2012 to August 31, 2012 inclusively	HUGS can break off, potentially causing a choking hazard.	Call Britax for replacement HUGS
Britax	I/C	Boulevard	E9LK11A E9LK11M E9LK11S E9LK13P E9LK13S	June 1, 2012 to August 31, 2012 inclusively	HUGS can break off, potentially causing a choking hazard.	Call Britax for replacement HUGS
Britax	I/C	Pavilion	E9LK41A E9LK41Q E9LK42D E9LK42Z E9LK43Q	June 1, 2012 to August 31, 2012 inclusively	HUGS can break off, potentially causing a choking hazard.	Call Britax for replacement HUGS
Britax	I/C	Advocate ClickTight	E9LV55N E9LV55Q E9LV55Z	1-Aug-2014 to 29-Jul-2015	Harness adjuster buttons (red) may remain down in the "release" position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child's movements while secured in the seat.	Call Britax for fix kit (lubricant for adjuster mechanism)

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Britax	I/C	Boulevard ClickTight	E9LV45Q E9LV45S E9LV46A E9LV46H	1-Aug-2014 to 29-Jul-2015	<u>Harness adjuster buttons (red) may remain down in the “release” position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child’s movements while secured in the seat.</u>	Call Britax for fix kit (lubricant for adjuster mechanism)
Britax	I/C	Marathon ClickTight	E9LV31Q E9LV35R E9LV36B E9LV36L E9LV36N	1-Aug-2014 to 29-Jul-2015	<u>Harness adjuster buttons (red) may remain down in the “release” position after the harness is tightened. This will enable the shoulder harnesses to loosen from a child’s movements while secured in the seat.</u>	Call Britax for fix kit (lubricant for adjuster mechanism)
Britax	C/B	Frontier XT	E9LC3H6 E9LC3H7 E9LC3M6	16-Feb-2010 to 12-Mar-2010	<u>The Frontier XT child/booster seats do not contain a sufficient amount of energy absorbing material to comply with the standard.</u>	Call Britax; continue use until repair kit has been received.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Chicco	I	KeyFit 30	7901201 7901210 7901250 7901302 7910202 7910505 7910568 7923705 7923750 7923751 7923768 7923770 7923781 7974736 7974872, 7976108 7976140 7976151 57976151	30-Dec-2013 to 21-May-2018	The infant seat did not meet the dynamic requirements for chest acceleration of the RSSR.	Acquire a fix kit. Continue to use the car seat using the universal anchorage system (UAS), lap only portion of the vehicle seat belt, or without the base until they receive a retrofit kit.
Clek	B	Oobr	OOBR - Noire colour only	1-Apr-2016 to 22-Nov-2016	Noire colour only; may not conform to the flammability requirements.	Obtain replacement fabric from Clek.
Clek	I/C	Foonf	F012C1 FOONF C1 2014 Foonf F014C1 F015C1 F016C1	1-Dec-2012 to 10-May-2016	When installed forward-facing with a lap belt only and top tether in Recline Position 1, the car seat did not meet the dynamic requirements for chest acceleration of the RSSR.	Use Recline Position 2 when FF with lap belt and tether; contact Clek for updated labels.
Cosco - see Dorel						
Diono	I/C/B	Radian R100	All	March 2011 to January 2012	Incorrect Weight on French Label	Call Diono
Diono	I/C/B	Radian R100 Radian R120 Radian RXT Radian GTX	C16600 C16800 C16900 C18600	Jan 2013 through November 2013	Radian child restraints were shipped without the required memory foam insert in the seat pan fabric	Call Diono

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Diono	B	Cambria Hip Backless Jet Backless	310000 221250 221200	22-Apr-2016 through 31-Dec-2016	The fabric pad of the affected booster seats do not conform to the flammability requirements	Call Diono for replacement cover.
Diono	B	Cambria	31010-CA 31030-CA 31110-CA 31120-CA	15-May-2014 to 15-Feb-2015	In the case of a vehicle fire, the fabric cover may not self-extinguish or may burn too quickly, accelerating the spread of the fire.	Contact Diono as soon as possible to obtain a replacement cover.
Diono	B	Little Tikes Booster Seat	221200	November 2013 through January 2014	Incorrect Labelling	Call Diono
Diono	B	LT HB Booster	221300	August 2014 through February 2015	Does not pass all dynamic tests.	Call Diono for replacement seat bottom.
Dorel	I/C	Safety 1st Guide 65	22660CTRN 22660CZIG	February 2, 2012 to November 8, 2012	During certain simulated crash tests with a 3 year-old test dummy and the restraint in rear-facing orientation, one side of the shell was observed to crack.	Call Dorel
Dorel	I/C	Eddie Bauer XRS 65	22701CAPH	February 2, 2012 to November 8, 2012	During certain simulated crash tests with a 3 year-old test dummy and the restraint in rear-facing orientation, one side of the shell was observed to crack.	Call Dorel
Dorel	I/C	Safety 1st Cruise Air 65, LX 65	22761CAGS 22762CAZX 22762CAUC	February 2, 2012 to November 8, 2012	During certain simulated crash tests with a 3 year-old test dummy and the restraint in rear-facing orientation, one side of the shell was observed to crack.	Call Dorel
Dorel	I/C/B	Safety 1st Enspira 65	22410CAUA	February 2, 2012 to November 8, 2012	During certain simulated crash tests with a 3 year-old test dummy and the restraint in rear-facing orientation, one side of the shell was observed to crack.	Call Dorel

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Dorel	I/C/B	Eddie Bauer Enspira 65	22742CLKW	February 2, 2012 to November 8, 2012	During certain simulated crash tests with a 3 year-old test dummy and the restraint in rear-facing orientation, one side of the shell was observed to crack.	Call Dorel
Eddie Bauer - see Dorel						
Evenflo	I	Embrace	24502459 24502701 31511098C 31511183C 31511323C 31511323CD 46811205C 47411419C 47411419CD 48111234C 48111235C 5291928C 52921040C 52921040CD 55311238	1-Jan-2012 to 30-Apr-2012 1-Jul-2012 to 31-Mar-2013 1-Aug-2011 to 28-Feb-2012 1-Nov-2011 to 31-Aug-2012 1-Jul-2012 to 31-Jan-2013 1-Mar-2013 to 31-Mar-2013 1-Jul-2012 to 31-Mar-2013 1-Dec-2012 to 31-May-2013 1-Nov-2012 to 30-Nov-2012 1-Nov-2011 to 30-Sep-2012 1-Nov-2011 to 31-Oct-2012 1-Feb-2013 to 30-Sep-2013 1-Jan-2013 to 31-Oct-2013 1-Jan-2013 to 31-Mar-2013 1-Jan-2012 to 30-Apr-2012	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo:

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	I	Embrace 35	24502459, 24502701, 31511098C, 31511183C, 31511323C, 31511683C, 3151953C, 3152953C, 46811205C, 46821205C, 47311215C, 47311330C, 47311359C, 47311559C, 47311559C, 47311561C, 47311561C, 47321330C, 47321559C, 47321561C, 47411419C, 48111234C, 48111235C, 48411413C, 48411592C, 48421507C, 48421592C, 48431507C, 5291928C, 52921040C, 55321238C	August 2011 to January 2015	Car seats may have an installation diagram label that incorrectly shows the position of the carry handle when the restraint is installed in the vehicle. In Canada, the handle should be in Position 1 for travel, and the incorrect label shows the handle in Position 4.	ONLY use Position 1 when installing their restraint in a vehicle.
Evenflo	I/C	SureRide	37111324C 37111334C 37111435C 37111623C 37111640C	17-Jun-2013 to 13-Aug-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	I/C	Titan 65	37111447C 37121597C	12-Dec-2013 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	I/C	Momentum	3851978C 3851998C 3852978C 3852998C 3853998C	25-Jan-2011 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	I/C	SureRide DLX	37111324C	1-Jun-2013 to 24-Jun-2013	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo for new buckle
Evenflo	I/C	Momentum 65 DLX	3853998C	01-May-2013 to 31-May-2013	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo for new buckle
Evenflo	C/B	Evolve 3-in-1	34411700C	Prior to 9-Feb-2016	Some children are able to reach the harness adjustment button and are loosening the harness.	Contact Evenflo
Evenflo	C/B	SecureKid 400	3081129C 30821269C	11-Jan-2012 to 18-Jul-2013	Incorrect French label affixed to the Secure Kid 400 booster seat	Contact Evenflo

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	C/B	Maestro	31011196C 31011270C 31011277C 31011277CD 31011433C 31011433CD 3101964C 3101964CD 3102979C	30-Oct-2011 to 17-Oct-2013 01-Apr-2012 to 17-Oct-2013 1-Nov-2011 to 01-Jan-2013 1-Dec-2011 to 31-Dec-2012 1-Dec-2012 to 17-Oct-2013 1-Dec-2012 to 31-Dec-2013 1-Dec-2012 to 17-Oct-2013 1-Dec-2012 to 30-Apr-2013 3-Oct-2011 to 31-May-2012	<u>The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.</u>	Contact Evenflo for new buckle
Evenflo	C/B	Chase LX and DLX	30611117C 30611377C 32911122C 32921139C 32921144C	1-Jul-2012 to 3-Oct-2013 1-Jul-2012 to 3-Oct-2013 28-Oct-2011 to 30-Apr-2012 4-Nov-2011 to 31-Jan-2012 4-Nov-2011 to 30-Nov-2011	<u>The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.</u>	Contact Evenflo for new buckle

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	I/C/B	Symphony	34511125C 34511264C 34511266C 34511650C 3451881C 3451953C 34521266C 3452881C 3452953C 34611038C 34611106C 34611176C 34611358C 34611376C 34611476C 34611587C 34611648C 34621038C 34621358C 34621376C 34631038C 34631358C 34641358C	31-Jan-2013 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit
Evenflo	I/C/B	Snugli All In One	34611341C 34611364C 34621341C 34621364C	7-Aug-2014 to 3-May-2015	Reports of the Central Front Adjuster (CFA) retaining screw loosening and/or detaching over time.	Contact Evenflo to receive a free remedy kit

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Evenflo	I/C/B	Symphony DLX, 65, LX/Snugli All in One	34511125C 34511264C 34511266C 34611038C 34611341C 34611358C 34611364C 34611376C 34621038C 34621358C 34621376C	30-Nov-2012 to 17-Jan-2013 30-Nov-2012 to 26-Aug-2013 30-Nov-2012 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 31-Jan-2013 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 31-Jan-2013 to 26-Aug-2013 30-Nov-2012 to 5-Mar-2013 25-Jan-2013 to 2-Aug-2013 30-Jan-2013 to 26-Aug-2013 30-Jan-2013 to 26-Aug-2013	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo for new buckle
Evenflo	B	Big Kid AMP	31921168C	29-Jun-2012	An error on a French label affixed to certain booster car seats	See notice for details
Ferrari - see TeamTex						
First Years - see TOMY						
Fisher-Price	C/B	Safe Voyage Grow-with-Me	FP3000C	22-Aug-2013	During a certain simulated crash test with a 6 year-old test dummy and the restraint in forward-facing orientation, the top tether strap tore out of the plastic back of the restraint system and the test dummy's head exceeded the maximum allowable forward excursion limit.	Contact Fisher-Price
Fisher-Price	C/B	Safe Voyage Grow-with-Me	FP3000C	14-Jun-2013 to 27-Aug-2013	Certain child restraint systems may not conform to the flammability requirements indicated in the RSSR	Contact 5514km
Graco	I	SnugRide and SnugRide 22	1805204 1871213	29-Jan- 2013, 27-Mar-2013 and 11-Apr-2014 8-Nov-2013	Specific base-carrier combination may increase the risk of injury in a crash.	Install without the base; contact the Canadian distributor at 1-800-667-8184

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Graco	I	SnugRide and SnugRide 22	1763080 1771793 1789383 1793562 1805076 1805077 1805189 1805204 1805270 1805293 1805294 1807872 1809000 1809352 1812134 1812846 1813567 1813569 1856994 1856996	March 2011 – May 2013	<u>The release button on the buckle guides the caregiver's finger to the center of the button, rather than towards the top. Consumers relying on touch and pressing in the center of the button may have more difficulty in releasing the harness than they would by pressing the button in the more optimal location near the top edge. Additionally, the position of the buckle close to the child occupant's thighs may cause manipulation of the buckle to be more difficult as the child occupant grows in size.</u>	Contact the Canadian distributor, Elfe Juvenile Products, at 1-800-667-8184 or service@graco.net to obtain a free repair kit
Graco	I	SnugRide 30	1810993 1812393 1814648 1818682 1819044 1819703 1819730 1819856 1826250 1853434 1860285	July 2010 – January 2013	<u>The release button on the buckle guides the caregiver's finger to the center of the button, rather than towards the top. Consumers relying on touch and pressing in the center of the button may have more difficulty in releasing the harness than they would by pressing the button in the more optimal location near the top edge. Additionally, the position of the buckle close to the child occupant's thighs may cause manipulation of the buckle to be more difficult as the child occupant grows in size.</u>	Contact the Canadian distributor, Elfe Juvenile Products, at 1-800-667-8184 or service@graco.net to obtain a free repair kit

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Graco	I	SnugRide 35	176060 1786420 1786501 1788617 1788618 1810490 1810511 1810997 1812135 1812178 1812179 1812395 1813829 1817149	May 2011 – January 2013	The release button on the buckle guides the caregiver's finger to the center of the button, rather than towards the top. Consumers relying on touch and pressing in the center of the button may have more difficulty in releasing the harness than they would by pressing the button in the more optimal location near the top edge. Additionally, the position of the buckle close to the child occupant's thighs may cause manipulation of the buckle to be more difficult as the child occupant grows in size.	Contact the Canadian distributor, Elfe Juvenile Products, at 1-800-667-8184 or service@graco.net to obtain a free repair kit
Graco	I	Aprica 30	1821131	July 2011 – April 2012	The release button on the buckle guides the caregiver's finger to the center of the button, rather than towards the top. Consumers relying on touch and pressing in the center of the button may have more difficulty in releasing the harness than they would by pressing the button in the more optimal location near the top edge. Additionally, the position of the buckle close to the child occupant's thighs may cause manipulation of the buckle to be more difficult as the child occupant grows in size.	Contact the Canadian distributor, Elfe Juvenile Products, at 1-800-667-8184 or service@graco.net to obtain a free repair kit
Graco	I/C	MyRide 65	1910553 1910552 1910395	14-May-2014 to 18-Jul-2014 11-Jul-2014 to 30-Jul-2014 14-May-2014	The webbing of the affected restraints do not conform to the breaking strength requirements indicated in the RSSR. Affected units have webbing tag code "2014/06"	Call Graco for replacement harness; use existing harness in the meantime.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Graco	I/C	MyRide 65	1760905 1760906 1760907 1761384 1768132 1812276 1814046 1858426 1858427 1866282	September 2008 to July 2013	<u>On certain Graco Nautilus and MyRide 65 model child car seats manufactured between September 2008 and July 2013, the buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.</u>	Call Elfe Juvenile Products
Graco	C/B	Nautilus	1749108 1749109 1749110 1749111 8J00GLX 8J00MTX 8J00BRV 8J00RSE 1759875 1773654 1782514 1783809 1784468 1803181 1803185 1803201 1804171 1809667 1810497 1813596 1857000 1857051 1859859 1861577	September 2008 to July 2013	<u>On certain Graco Nautilus and MyRide 65 model child car seats manufactured between September 2008 and July 2013, the buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.</u>	Call Elfe Juvenile Products

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Graco	B	Turbo	1971444 1970763	27-Feb-2016 to 12-Apr-2016 26-Feb-2016	The instruction manual does not contain a statement indicating that the booster seat, even when unoccupied, must be firmly secured to the vehicle.	Download revised manual; secure booster to vehicle.
Harmony	C/B	V7	0302001TNC	7-Dec-2011 to 2-Nov-2012	Harmony Juvenile Products and Transport Canada wish to inform the public of a non-compliance observed during compliance verification testing that was performed by Transport Canada.	See notice for details
Harmony	C/B	V7	0302001TNC	7-Dec-2011 to 2-Nov-2012	Harmony Juvenile Products and Transport Canada wish to inform the public of a non-compliance observed during compliance verification that was performed by Transport Canada.	See notice for details
Harmony	C/B	V7	0302001TNC	7-Dec-2011 to 7-Jan-2012	Harmony Juvenile Products and Transport Canada wish to inform the public of an error in the instruction manual provided with a limited number of V7 convertible car seats.	See notice for details
Harmony	C/B	Optyma	0302010RBK	27-Dec-2017 to 2-Jan-2018 with serial number ranges YY20171227677200001-00489 YY20171229677300001-00473 YY20180102677400001-00473 YY20171229677700001-00060	If the straps are positioned without covering the opening on the splitter plate, they can potentially loosen or become unsecured from the splitter plate.	Contact Harmony for sleeve to cover splitter plate opening
Lamaze - see TOMY						
Little Tikes - see Diono						

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
KidsEmbrace	C/B	KidsEmbrace Friendship Series	Cinderella (Model Number: 40000CINCAN) TMNT Leo (65500LEOCAN) Ultimate Spider-Man (40000SPDCAN)	Cinderella: 2015-02-02 and 2015-02-06 TMNT Leo : 2015-01-09 to 2015-11-06 Ultimate Spider-Man: 2015-01-09 to 2015-11-06	The lower connector system does not meet the dimensional requirements of CMVSS; the connector appears to be too long.	Install with seat belt if connectors are too long; call for new connectors.
KidsEmbrace	C/B	KidsEmbrace Friendship Series Cinderella Combination Booster Seat	40000CINCAN	2-Feb-2015 to 6-Feb-2015	An English label incorrectly states the booster seat can be used for children with a minimum weight of 14 kg (30 lbs). The weight range is 18 to 45 kg (40 to 100lbs).	Do not use the product as a belt-positioning booster if the child weighs less than 18 kg (40 lbs). Contact KidsEmbrace for replacement label.
Kukuxumusu	B	Kukuxumusu	046-0735 (KU20143CM) 046-0736 (KU20153CM)	February 2013 to September 2015	Does not meet the stiffness requirements or conform to flammability requirements of the RSSR.	Discontinue use; return affected product to Canadian Tire
Orbit Baby Inc.	I	Orbit Baby G3 Infant Car Seat	ORB832300	December 2013 through December 2016	Does not meet dynamic testing requirements when used without the base; does not meet label permanency requirements.	Contact Orbit Baby. Do not use without the base.
Orbit Baby Inc.	I	Orbit Car Seat Base G2	ORB822000	20-Mar-2013 to 20-Jul-2013 with batch numbers A0840, A0860 and A0880	StrongArm™ knob on the affected Car Seat Base G2 units, used to securely tighten the base into the vehicle, may detach or spin without tightening the base, preventing the installation of the car seat base in accordance with the instructions.	Contact Orbit Baby.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Quinny - see Dorel						
Safety 1st - see Dorel						
Recaro	I/C	Performance RIDE	337.01.KNGT 337.01.MNGT 337.01.REDD 337.01.VIBE	30-Oct-2015 to 19-Jan-2016 13-Oct-2015 to 4-Dec-2015 3-Nov-2015 to 4-Dec-2015 16-Oct-2015 to 17-Feb-2016	Do not meet the dynamic requirements for head acceleration in the RSSR.	Use bottom half of infant insert to 35lb limit RF; remove weight limit tag; get update manual. Contact Recaro.
Recaro	I/C	Performance RIDE	337.01.MNGT 337.01.KNGT 337.01.VIBE 337.01.REDD	13-Oct-2015 to 3-Nov-2015	The date of manufacture on the side of the child restraint was misprinted and may be inconsistent with normal date formats.	Contact Recaro for replacement label.
Schwinn - see Dorel						
Snugli (Evenflo)	I	Infant Seat (Embrace)	30711365C	1-Feb-2013 to 28-Feb-2013	The buckle may become contaminated with foreign material, such as food or dried liquids. Over time, the buckle may become progressively more difficult to unlatch or become stuck in the latched position.	Contact Evenflo;
Snugli (Evenflo)	I	Infant Seat (Embrace)	30721365C, 30711365C	August 2011 to January 2015	Car seats may have an installation diagram label that incorrectly shows the position of the carry handle when the restraint is installed in the vehicle. In Canada, the handle should be in Position 1 for travel, and the incorrect label shows the handle in Position 4.	ONLY use Position 1 when installing their restraint in a vehicle.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
Sparco	B	No Back Booster	00924AZ+NRGR	all	In the case of a vehicle fire, the fabric cover may not self-extinguish or may burn too quickly, accelerating the spread of the fire.	Discontinue use of their product; return to Canadian Tire for refund.
TeamTex	C/B	Fisher Price Safe Voyage Grow-with-Me	FP3000C	November 30 2012 to August 27, 2013	Misleading language in manual - harness should be at or JUST above the shoulders.	Use harness at or JUST above shoulders; obtain new manual.
TeamTex	B	Ferrari Befix High Back Booster	F4000C	13-Aug-2013 16-Aug-2013 27-Aug-2013 5-Sep-2013 6-Sep-2013 9-Sep-2013 12-Sep-2013 17-Sep-2013 19-Sep-2013 25-Sep-2013	Possible incorrect shoulder belt routing instructions for two different belt guide types. Without the correct instructions, it may be possible to have the vehicle shoulder belt routed incorrectly, preventing the belt from sliding freely in the guide.	Contact the 5514 KM Corporation and obtain revised instructions if current ones do not match type on seat.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
TeamTex	B	Barbie Sparkle Backless Booster Ferrari Dream Backless Booster Ferrari Befix High Back Booster Ferrari Beline Car Seat Fisher-Price Safe Voyage Backless Booster Fisher-Price Safe Voyage High Back Booster Fisher-Price Safe Voyage Grow with Me Car Seat Hot Wheels Flame Backless Booster Hot Wheels Speedway Backless Booster	MB5000C F5000C F4000C F3000C FP5000C FP4000C FB3000C MH5000C MH5000C	November 30 2012 to June 5 2014	Some labels on the affected booster seats and certain sections in the instruction manual indicate a minimum height of 40 inches (102 cm), while others indicate a minimum height of 42 inches (107 cm). In addition, there are some translation errors between the English and French manuals.	Contact the 5514 KM Corporation for updated labels and manual. Utilize minimum height of 42" (107cm)
TOMY	I	First Years Via I470C First Years T230c Lamaze Indigo Travel System Lamaze Indigo Via	Y11228C Y11248C Y11272C and Y11282C Y11289C	May 2011 to March 2012	Does not meet head and chest injury limits; adjustable recline foot may not remain in position.	DO NOT USE; call TOMY at 1-888-899-2229 for more information.

Recall List - updated 31-Aug-2018 - While every effort has been made to ensure the accuracy of this list it is always advisable to have parents confirm with Transport Canada and/or their CRS manufacturer whether their specific seat is subject to a Public Notice or Consumer Information Notice. This list is a summary, and provided for quick reference only by the Child Passenger Safety Association of Canada.

Company	Type	Model Name	Model Number	Date of Manufacture Affected	Issue	Action
UPPAbaby	I	Mesa	0209-JKE 0209-DNY 0209-GEO 0209-PAS 0209-LSY	17-Oct-2015 to 21-Mar-2017	An installation diagram label at the belt path incorrectly shows the position of the carry handle when the car seat is installed in a vehicle.	Use forward "vehicle use" handle position in the vehicle; contact UPPAbaby for a corrected label
Volvo	B		850 - 1998 S40 - 01-05 V40 - 01-04 V50 - 05-06 V70 - 00-06 XC70 - 01-06 XC90 - 03-06	See list at left	Inappropriate weight range.	Do not use integrated booster until 40lbs